


MPC 6000 Grounding Plate

NATT #: 02037013 (Pack of 4)

For use in:

AF MPC6000/ AF MPC6501/ AF MPC7500/ AF MPC7501
C6055/ C7570/ C9065/ C9075/ LD260c/ LD275c/ LD365c
LD375c

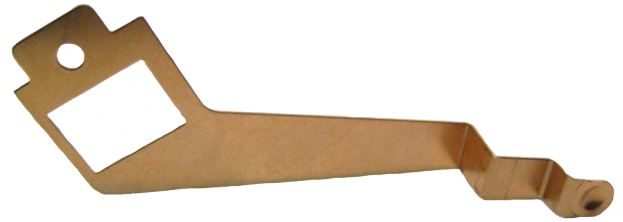

Background Information and Discussion of Problem:

Symptoms may include: poor copy quality (light copies), excessive toner dusting around development units, and background (fogging) on prints.

These symptoms may result in increased developer replacement, more frequent PMs, reduced image quality, and an overall decrease in efficient of consumable parts.

Testing confirms that ground can float between 0 and 1,000 ohms without the grounding plate installed.


Causes:

Intermittent and unreliable ground through the drum bearing in the front plate.

Solution:

NA Trading's Grounding Plates (four per machine) are fitted to the front plate of a machine utilizing the existing screw for the air duct. The plates also use the existing air passage coupler under the clear acrylic air duct and do not interfere with the sealing integrity of the duct. Once installed, the ground plate will not need to be removed for maintenance.

Testing confirms that ground measures 0 ohms with the plate installed.

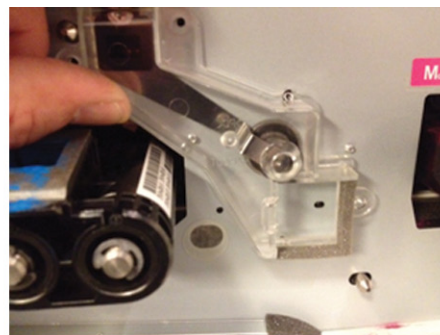

To learn more about **NA Trading** and our complete line of **Repair Items**, contact a product specialist or visit us online today.

800 231 8434

www.natrading.com